



SOUND TRANSMISSION LOSS TEST REPORT NO. TL18-199

CLIENT: **ClarkDietrich**
9050 Centre Pointe Drive, #400
West Chester, Ohio 45069

19 March 2018

TEST DATE: 1 March 2018

INTRODUCTION

The test was performed in accordance with ASTM E 90-09 (2016), *Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions* and ASTM E2235-04 (2012), *Standard Test Method for Determination of Decay Rates for Use in Sound Insulation Test Methods*. Copies of the test standard are available at www.astm.org. The test chamber source and receiving room volumes are 204 and 148.4 cubic meters respectively. Western Electro-Acoustic Laboratory is accredited by the United States Department of Commerce, National Institute of Standards and Technology under the National Voluntary Accreditation Program (NVLAP) Lab Code 100256-0 for this test procedure. This test report relates only to the item(s) tested. This report must not be used to claim product certification, approval, or endorsement by WEAL, NVLAP, NIST or any agency of the federal government.

DESCRIPTION OF TEST SPECIMEN

The test specimen was a single stud wall assembly constructed from 92 mm (3-5/8 inch) ClarkDietrich ProSTUD® 25 (25-gauge EQ) steel studs with 92 mm (3-5/8 inch) ClarkDietrich ProTRAK® 25 (25-gauge EQ) steel track, Johns Manville R-11 unfaced fiberglass insulation in the stud cavities, ClarkDietrich Acoustical Clips with 22 mm (7/8 inch) ClarkDietrich 25-gauge hat channel, and USG Sheetrock® Brand Firecode® Type 'X' gypsum board.

TEST CONFIGURATION

Source Room Layers	Source Room Resilient Clip	Stud Configuration	Receiving Room Layers
1 layer 16 mm (5/8 inch) USG Sheetrock® Brand Firecode® Type 'X' gypsum board	ClarkDietrich Acoustical Clips with 22 mm (7/8 inch) ClarkDietrich 25-gauge hat channel	92 mm (3-5/8 inch) ClarkDietrich ProSTUD® 25 (25-gauge EQ) steel studs with 92 mm (3-5/8 inch) ClarkDietrich ProTRAK® 25 (25-gauge EQ) steel track with Johns Manville R-11 unfaced fiberglass insulation	1 layer 16 mm (5/8 inch) USG Sheetrock® Brand Firecode® Type 'X' gypsum board

- The 92 mm (3-5/8 inch) ClarkDietrich ProSTUD® 25 (25-gauge EQ) steel studs were spaced 406 mm (16 inches) on center (O.C.) and screwed into the ClarkDietrich ProTRAK® 25 (25-gauge EQ) steel track with 12 mm (1/2 inch) truss screws. Johns Manville R-11 unfaced fiberglass insulation was installed in the stud cavities. The frame was isolated from the test opening with 6 mm (1/4 inch) neoprene pads.
- On the source side, ClarkDietrich Acoustical Clips were screwed to the studs using 38 mm (1-1/2 inch) #8 screws. The clips were installed 152 mm (6 inches) from the top and bottom of the wall with a maximum spacing of 1219 mm (48 inches) O.C. laterally and a maximum spacing of 610 mm (24 inches) vertically.
- On the source side, 22 mm (7/8 inch) ClarkDietrich 25-gauge hat channel was installed into the sound isolation clips.
- On the source side, one layer of 16 mm (5/8 inch) USG Sheetrock® Brand Firecode® Type 'X' gypsum board was screwed to the hat channel using 25 mm (1 inch) long #6 drywall screws spaced at 203 mm (8 inches) O.C. along the channel.
- On the receiving side, one layer of 16 mm (5/8 inch) USG Sheetrock® Brand Firecode® Type 'X' gypsum board was screwed to the studs using 25 mm (1 inch) long #6 drywall screws spaced 203 mm (8 inches) O.C. along the perimeter and 305 mm (12 inches) O.C. in the field.





SOUND TRANSMISSION LOSS TEST REPORT NO. TL18-199

CLIENT: **ClarkDietrich**
9050 Centre Pointe Drive, #400
West Chester, Ohio 45069

19 March 2018

TEST DATE: 1 March 2018

- All gypsum board and plywood sheathing was oriented vertically, and the joints were staggered on opposite sides. All the gypsum board joints were sealed with a bead of latex caulking and metal foil tape. All screw heads were covered with metal foil tape.
- On both sides around the perimeter of the assembly, a 6 mm (1/4 inch) gap was maintained and sealed with a bead of latex caulking and metal foil tape.
- The overall dimensions of the wall assembly were 2.44 m (96 inches) wide by 2.44 m (96 inches) high by 165 mm (6-1/2 inches) thick.
- The overall weight of the assembly was estimated to be 148 kg (326 lbs.) for a calculated surface density of 24.8 kg/m² (5.1 lbs./ft²).

RESULTS OF THE MEASUREMENTS

One-third octave band sound transmission loss values are plotted and tabulated on the attached sheet. ASTM minimum volume requirements are met at 80 Hz and above. The Outdoor-Indoor Transmission Class rating determined in accordance with ASTM E 1332-10a was OITC-38. The Sound Transmission Class rating determined in accordance with ASTM E 413-10 was STC-56.

Approved:

Stephen A. Martin, Ph.D., P.E.
Laboratory Director

Respectfully submitted,
Western Electro-Acoustic Laboratory


Chris Kezon
Acoustical Test Engineer



SOUND TRANSMISSION LOSS TEST REPORT NO. TL18-199

CLIENT: **ClarkDietrich**
 9050 Centre Pointe Drive, #400
 West Chester, Ohio 45069
 TEST DATE: 1 March 2018

19 March 2018

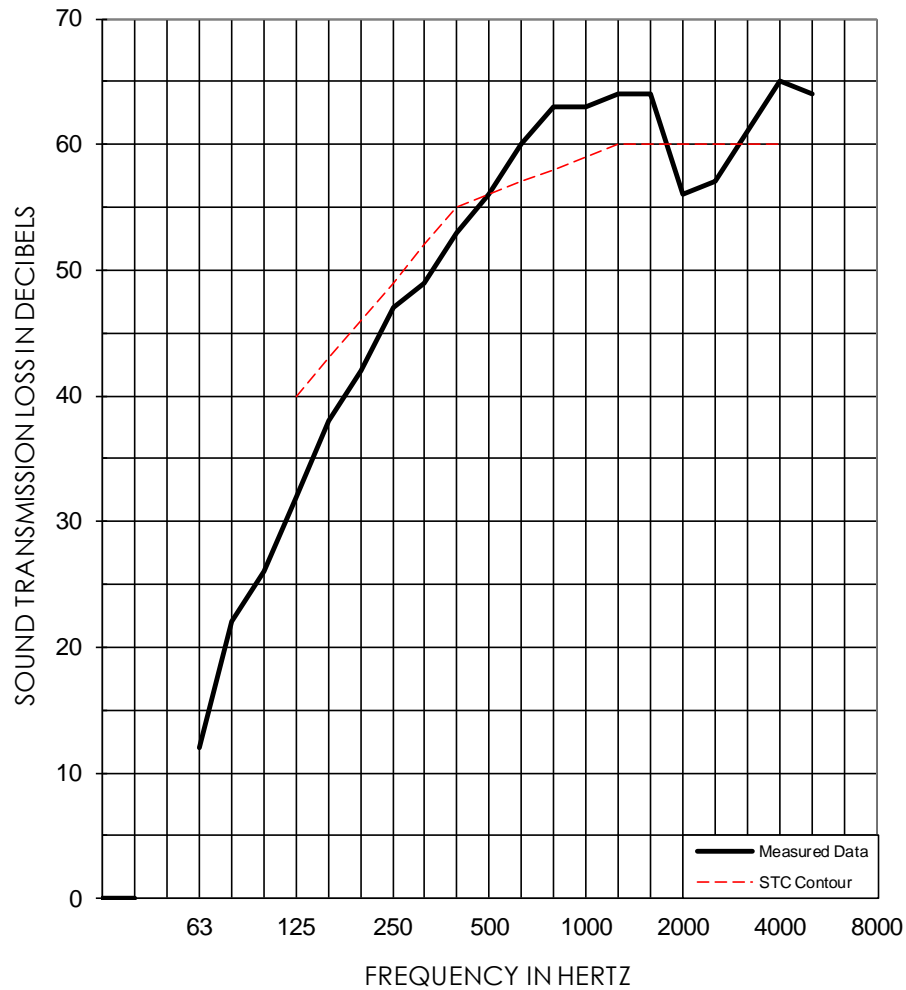

1/3 OCT BAND CNTR FREQ	63	80	100	125	160	200	250	315	400	500
TL in dB	12	22	26	32	38	42	47	49	53	56
95% Confidence in dB deficiencies	1.42	1.92	2.07	1.47	0.89	0.76	0.80	0.52	0.36	0.38
				(8)	(5)	(4)	(2)	(3)	(2)	(0)
1/3 OCT BAND CNTR FREQ	630	800	1000	1250	1600	2000	2500	3150	4000	5000
TL in dB	60	63	63	64	64	56	57	61	65	64
95% Confidence in dB deficiencies	0.29	0.44	0.38	0.39	0.36	0.56	0.55	0.31	0.32	0.50
						(4)	(3)			

EWR	OITC	Test Date: 01 March 2018	STC
55	38	Specimen Area: 64 sq.ft.	56
		Temperature: 67.3 deg. F	(31)
		Relative Humidity: 34 %	

Report must be distributed in its entirety except with written permission from Western Electro-Acoustic Laboratory



SOUND TRANSMISSION LOSS TEST REPORT NO. TL18-199

CLIENT: **ClarkDietrich**
9050 Centre Pointe Drive, #400
West Chester, Ohio 45069
TEST DATE: 1 March 2018

19 March 2018

PHOTOGRAPHS OF TEST SPECIMEN

