

CLARKDIETRICH BUILDING SYSTEMS, LLC ACOUSTICAL PERFORMANCE TEST REPORT

SCOPE OF WORK

ASTM E90 SOUND TRANSMISSION LOSS TESTING ON A UL-V438, WALL SYSTEM

REPORT NUMBER

L3173.14-113-11-R0

TEST DATE

10/20/20

ISSUE DATE


01/06/21

PAGES

11

DOCUMENT CONTROL NUMBER

RT-R-AMER-Test-2758 (01/24/19) © 2017 INTERTEK

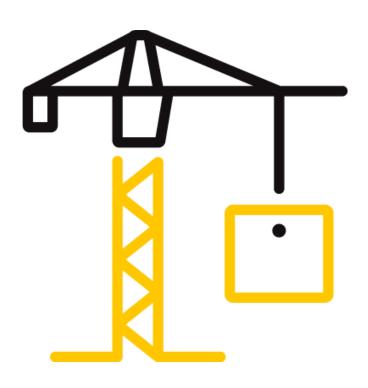



Telephone: 717-764-7700 Facsimile: 717-764-4129 www.intertek.com/building

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.14-113-11-R0

Date: 01/06/21

REPORT ISSUED TO

CLARKDIETRICH BUILDING SYSTEMS, LLC 9050 Centre Pointe Drive

West Chester, Ohio 45069

SECTION 1

SCOPE

Intertek Building & Construction (B&C) was contracted by ClarkDietrich Building Systems, LLC to conduct a sound transmission loss test. Results obtained are tested values and were secured by using the designated test methods. The complete test data is included herein. The client provided the test specimen. All measurements were conducted in the HT test chambers at Intertek B&C located in York, Pennsylvania.

This report does not constitute certification of this product nor an opinion or endorsement by this laboratory. Intertek B&C will service this report for the entire test record retention period. The test record retention period ends four years after the test date. Test records, such as detailed drawings, datasheets, representative samples of test specimens, or other pertinent project documentation, will be retained for the entire test record retention period.

For INTERTEK B&C:

Zachary P. Golden Kurt A. Golden **COMPLETED BY: REVIEWED BY:** Technician Team Leader **Project Lead** TITLE: **Acoustical Testing** TITLE: **Acoustical Testing SIGNATURE: SIGNATURE:** 01/06/21 01/06/21 DATE: DATE:

ZPG:jmcs

This report is for the exclusive use of Intertek's Client and is provided pursuant to the agreement between Intertek and its Client. Intertek's responsibility and liability are limited to the terms and conditions of the agreement. Intertek assumes no liability to any party, other than to the Client in accordance with the agreement, for any loss, expense or damage occasioned by the use of this report. Only the Client is authorized to permit copying or distribution of this report and then only in its entirety. Any use of the Intertek name or one of its marks for the sale or advertisement of the tested material, product or service must first be approved in writing by Intertek. The observations and test results in this report are relevant only to the sample(s) tested. This report by itself does not imply that the material, product, or service is or has ever been under an Intertek certification program.





Telephone: 717-764-7700 Facsimile: 717-764-4129 www.intertek.com/building

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.14-113-11-R0

Date: 01/06/21

SECTION 2

SUMMARY OF TEST RESULTS

SERIES/MODEL	UL-V438
ТҮРЕ	Wall System
DATA FILE NO.	L3173.01H1
INSULATION TYPE	2-3/4" Fiberglass Unfaced
STC	59
OITC	42

SECTION 3

TEST METHODS

The specimens were evaluated in accordance with the following:

ASTM E90-09 (2016), Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions and Elements

ASTM E413-16, Classification for Rating Sound Insulation

ASTM E1332-16, Standard Classification for Rating Outdoor-Indoor Sound Attenuation

ASTM E2235-04 (2020), Standard Test Method for Determination of Decay Rates for Use in Sound Insulation Test Methods

SECTION 4

SPECIMEN INSTALLATION

The specimen was constructed in the laboratory. A sound transmission loss test was initially performed on a filler wall. The 96" wide by 96" high specimen plug was removed from the filler wall assembly. The specimen was placed on an isolation pad in the test opening. Duct seal was used to seal the perimeter of the specimen to the test opening on both sides. The interior side of the specimen, when installed, was approximately 1/4" from being flush with the receive room side of the filler wall. A stethoscope was used to check for any abnormal air leaks around the test specimen prior to testing.



Telephone: 717-764-7700 Facsimile: 717-764-4129 www.intertek.com/building

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.14-113-11-R0

Date: 01/06/21

SECTION 5

EQUIPMENT

The equipment listed below meets the requirements of the test methods stated in Section 3 of this report.

INSTRUMENT	MANUFACTURER	MODEL	DESCRIPTION	ASSET#	CAL
					DATE
Data Acquisition Card	National Instruments	PXI-4462	Data Acquisition Card	63763-3*	04/20
Data Acquisition Card	National Instruments	PXI-4462	Data Acquisition Card	65125*	05/20
Data Acquisition Card	National Instruments	PXI-4462	Data Acquisition Card	65126*	05/20
Source Room Microphone	PCB Piezotronics	378C20	Microphone and Preamplifier	65968	01/20
Source Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	64903	09/20
Source Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	65103	03/20
Source Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	64905	03/20
Source Room Microphone	PCB piezotronics	378B20	Microphone and Preamplifier	64906	03/20
Receive Room Microphone	PBC Piezotronics	378B20	Microphone and Preamplifier	64907	01/20
Receive Room Microphone	PCB Piezotronics	378C20	Microphone and Preamplifier	64908	01/20
Receive Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	64909	01/20
Receive Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	64910	01/20
Receive Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	65586	08/20
Receive Room Environmental Indicator	Comet	T7510	Receive Room	64915	01/20
Source Room Environmental Indicator	Comet	T7510	Source Room	64914	02/20
Microphone Calibrator	Norsonic	1251	Acoustical Calibrator	Y002919	04/20

 $[\]hbox{\it *-} Note: The \ calibration \it frequency \it for this \it equipment \it is \it every \it two \it years \it per \it the \it manufacturer's \it recommendation.$

TEST CHAMBER

	VOLUME	DESCRIPTION
RECEIVE ROOM	234 m³	Rotating vane and stationary diffusers
		Temperature and humidity controlled
		Isolation pads under the floor
SOURCE ROOM	207 m³	Stationary diffusers only Temperature and humidity controlled

<u> </u>	MAXIMUM SIZE	DESCRIPTION
TL TEST OPENING	4.27 m wide by 3.05 m high	Vibration break between source and receive rooms



Telephone: 717-764-7700 Facsimile: 717-764-4129 www.intertek.com/building

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.14-113-11-R0

Date: 01/06/21

SECTION 6

LIST OF OFFICIAL OBSERVERS

NAME	COMPANY
Adam Shoemaker	ClarkDietrich Building Systems, LLC
Zachary Golden	Intertek B&C
Kurt Golden	Intertek B&C

SECTION 7

TEST PROCEDURE

The sensitivity of the microphones was checked before measurements were conducted.

The transmission loss values were obtained for a single direction of measurement.

Two background noise sound pressure level and five sound absorption measurements were conducted at each of five microphone positions.

Two sound pressure level measurements were made simultaneously in receive and source rooms at each of five microphone positions.

The air temperature and relative humidity conditions were monitored and recorded during all measurements.

Data for flanking limit tests, repeatability measurements, and reference specimen tests are available upon request.

Intertek B&C will store samples of test specimens for four years.

SECTION 8

ACOUSTICAL TEST CALCULATIONS

Transmission loss (TL) at each 1/3 octave frequency is the average source room sound pressure level minus the average receive room sound pressure level, plus, 10 times the log of the specimen area divided by the sound absorption of the receive room with the sample in place.

STC Rating

To obtain the Sound Transmission Class (STC), read the TL of the contour curve at 500 Hz. The sum of the deficiencies below the contour curve must not exceed 32. The maximum deficiency at any one frequency must not exceed 8.

OITC Rating

The Outdoor-Indoor Transmission Class (OITC) is calculated by subtracting the logarithmic summation of the TL values from the logarithmic summation of the A-weighted transportation noise spectrum stated in ASTM E1332.



Telephone: 717-764-7700 Facsimile: 717-764-4129 www.intertek.com/building

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.14-113-11-R0

Date: 01/06/21

SECTION 9

SPECIMEN DESCRIPTION

SOURCE SIDE GYPSUM BOARD	Two Layers 1/2" Type C			
FURRING CHANNELS	25 Gauge (18 mil)			
STUD TREATMENT	ClarkDietrich Sound Clip (CDSC)			
STUDS	1-5/8" ProSTUD 25 (15 mil), 25-Gauge Equivalent Steel,			
	24" Centers			
TRACK	1-5/8" ProTRAK 25 (15 mil), 25-Gauge Equivalent Steel			
INSULATION	2-3/4" Fiberglass unfaced			
RECEIVE SIDE GYPSUM BOARD	Two Layers 1/2" Type C			

MATERIAL	ACTUAL DIMENSIONS (inches)	ACTUAL THICKNESS (inches)	MANUFACTURER AND SERIES	QUANTITY	AVERAGE WEIGHT	
SOURCE SIDE GYPSUM	48 by 96	0.5	1/2" USG Sheetrock® Brand Firecode® C Panels (UL Type C)	4 sheets	2.00 lbs/ft ²	
BOARD	cente	rs. Board joint	paced on 12" centers. Base s staggered. Perimeter and e. Screw heads sealed with	l joints sealed i		
FURRING	2-23/32 by 96	0.002	7/8" Steel, 25 gauge (18 mil)	5 pieces	0.24 lbs/linear ft	
CHANNEL	Note: Space	ed on 24" cente	ers perpendicular to studs,	friction fit into	clips.	
STUD	3 by 1-1/4	0.04	ClarkDietrich Sound Clip™ (CDSC)	15 pieces	0.13 lbs each	
TREATMENT	Note: Used to attach furring channels. Clips spaced on 48" centers.					
STUD	1-1/4 by 96	1-5/8"	ClarkDietrich ProSTUD® 25 (15 mil), Steel	5 pieces	0.24 lbs/linear ft	
	Note: Space	ed on 24" cente	ers. Screwed to top and bot	tom track.		
INSULATION	24 by 96	3.5	Johns Manville unfaced fiberglass batts	4 pieces	0.11 lbs/ft ²	
	<i>Note:</i> Fiction	n fit				
RECEIVE SIDE	48 by 96	0.5	1/2" USG Sheetrock® Brand Firecode® C Panels (UL Type C)	4 sheets	2.00 lbs/ft ²	
GYPSUM BOARD	Note: Base layer screws spaced on 16" centers. Face layer screws spaced on 16" centers with screws offset 8" from the base layer. Board joints staggered.					
	Perin		s sealed with acoustical sec	-		
TOP/ BOTTOM TRACK	1-1/4 by 96	1-5/8"	ClarkDietrich ProTRAK® 25 (15 mil), Steel	2 pieces	0.22 lbs/linear ft	



Telephone: 717-764-7700 Facsimile: 717-764-4129 www.intertek.com/building

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.14-113-11-R0

Date: 01/06/21

TOTAL WEIGHT (lbs)	AVERAGE WEIGHT (lbs/ft²)
543.71	8.50

Photographs are included in Section 11.

The client did not supply a report drawing of the test specimen.



Telephone: 717-764-7700 Facsimile: 717-764-4129 www.intertek.com/building

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.14-113-11-R0

Date: 01/06/21

SECTION 10

TEST RESULTS

L3173.01H1 DATA

SPECIMEN AREA	5.95 m ²	RECEIVE TEMP.	22.7 °C	SOURCE TEMP	23.1 °C
TECHNICIAN	Zachary Gol	RECEIVE HUMIDITY	51%	SOURCE HUMIDIT	49%

FREQ	BACKGROUND	ABSORPTION	SOURCE	RECEIVE	SPECIMEN	95%	NUMBER
	SPL		SPL	SPL	TL	CONFIDENCE	OF
(Hz)	(dB)	(m²)	(dB)	(dB)	(dB)	LIMIT	DEFICIENCIES
80	39.7	6.2	107	81	26	2.10	-
100	34.2	5.4	107	77	30	2.10	-
125	35.2	5.6	107	72	35	1.37	8
160	37.9	5.2	111	69	42	0.80	4
200	34.8	5.0	110	64	46	0.70	3
250	29.8	5.5	107	57	50	0.91	2
315	23.5	5.8	108	54	55	0.42	0
400	23.1	6.1	110	53	57	0.68	1
500	21.0	6.4	109	51	57	0.40	2
630	19.8	6.1	107	53	54	0.29	6
800	16.0	6.4	106	48	58	0.21	3
1000	12.1	6.6	108	44	63	0.37	0
1250	12.7	7.1	107	39	67	0.26	0
1600	9.6	7.6	105	35	69	0.24	0
2000	7.7	7.9	106	37	67	0.29	0
2500	7.7	9.0	106	40	64	0.35	0
3150	8.2	10.4	104	36	66	0.17	0
4000	10.6	12.9	103	28	71	0.24	0
5000	11.4	16.1	103	23	75	0.36	-
STC RATIN	iG	59	(Sound Trans	smission Class	s)		
DEFICIENC	CIES	29	(Sum of Deficiencies)			_	
OITC RATI	NG	42	(Outdoor-Indoor Transmission Class)				

Notes:

¹⁾ Receive Room levels less than 5 dB above the Background levels are red.

²⁾ Specimen TL levels listed in red indicate the lower limit of the transmission loss.

³⁾ Specimen TL levels listed in green indicate that there has been a filler wall correction applied




Telephone: 717-764-7700 Facsimile: 717-764-4129 www.intertek.com/building

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.14-113-11-R0

Date: 01/06/21

L3173.01H1 GRAPH

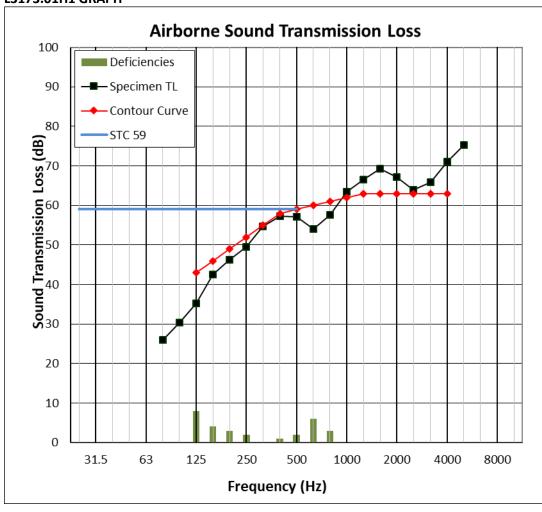



Telephone: 717-764-7700 Facsimile: 717-764-4129 www.intertek.com/building

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.14-113-11-R0

Date: 01/06/21

SECTION 11

PHOTOGRAPHS



Photo No. 1
Receive Room View of Installed Specimen



Photo No. 2 Source Room View of Installed Specimen



Telephone: 717-764-7700 Facsimile: 717-764-4129 www.intertek.com/building

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.14-113-11-R0

Date: 01/06/21

SECTION 12

REVISION LOG

REVISION #	DATE	PAGES	REVISION
0	01/06/21	N/A	Original Report Issue