

# CLARKDIETRICH BUILDING SYSTEMS, LLC ACOUSTICAL PERFORMANCE TEST REPORT

SCOPE OF WORK ASTM E90 SOUND TRANSMISSION LOSS TESTING ON A UL-U493, CHASE WALL SYSTEM

**REPORT NUMBER** L3173.06-113-11-R0


**TEST DATE** 10/15/20

**ISSUE DATE** 01/06/21

PAGES

11

DOCUMENT CONTROL NUMBER RT-R-AMER-Test-2758 (01/24/19) © 2017 INTERTEK

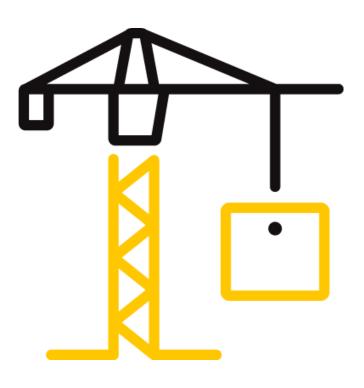



130 Derry Court York, Pennsylvania 17406

Telephone: 717-764-7700 Facsimile: 717-764-4129 www.intertek.com/building

#### TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.06-113-11-R0 Date: 01/06/21

#### **REPORT ISSUED TO**

**CLARKDIETRICH BUILDING SYSTEMS, LLC** 9050 Centre Pointe Drive West Chester, Ohio 45069

#### **SECTION 1**

#### SCOPE

Intertek Building & Construction (B&C) was contracted by ClarkDietrich Building Systems, LLC to conduct a sound transmission loss test. Results obtained are tested values and were secured by using the designated test methods. The complete test data is included herein. The client provided the test specimen. All measurements were conducted in the HT test chambers at Intertek B&C located in York, Pennsylvania.

This report does not constitute certification of this product nor an opinion or endorsement by this laboratory. Intertek B&C will service this report for the entire test record retention period. The test record retention period ends four years after the test date. Test records, such as detailed drawings, datasheets, representative samples of test specimens, or other pertinent project documentation, will be retained for the entire test record retention period.

#### For INTERTEK B&C: Zachary P. Golden Kurt A. Golden **COMPLETED BY: REVIEWED BY: Technician Team Leader** Project Lead TITLE: Acoustical Testing TITLE: **Acoustical Testing SIGNATURE: SIGNATURE:** 01/06/21 01/06/21 DATE: DATE: ZPG:jmcs

This report is for the exclusive use of Intertek's Client and is provided pursuant to the agreement between Intertek and its Client. Intertek's responsibility and liability are limited to the terms and conditions of the agreement. Intertek assumes no liability to any party, other than to the Client in accordance with the agreement, for any loss, expense or damage occasioned by the use of this report. Only the Client is authorized to permit copying or distribution of this report and then only in its entirety. Any use of the Intertek name or one of its marks for the sale or advertisement of the tested material, product or service must first be approved in writing by Intertek. The observations and test results in this report are relevant only to the sample(s) tested. This report by itself does not imply that the material, product, or service is or has ever been under an Intertek certification program.





# TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.06-113-11-R0 Date: 01/06/21

#### **SECTION 2**

#### SUMMARY OF TEST RESULTS

SERIES/MODEL	UL-U493			
ТҮРЕ	Chase Wall System			
DATA FILE NO.	L3173.01D3			
INSULATION TYPE	R-13 Fiberglass Unfaced			
STC	60			
OITC	44			

## SECTION 3

#### **TEST METHODS**

The specimens were evaluated in accordance with the following:

**ASTM E90-09 (2016),** Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions and Elements

ASTM E413-16, Classification for Rating Sound Insulation

**ASTM E1332-16,** Standard Classification for Rating Outdoor-Indoor Sound Attenuation

**ASTM E2235-04 (2020),** Standard Test Method for Determination of Decay Rates for Use in Sound Insulation Test Methods

## SECTION 4

#### SPECIMEN INSTALLATION

The specimen was constructed in the laboratory. A sound transmission loss test was initially performed on a filler wall. The 96" wide by 96" high specimen plug was removed from the filler wall assembly. The specimen was placed on an isolation pad in the test opening. Duct seal was used to seal the perimeter of the specimen to the test opening on both sides. The interior side of the specimen, when installed, was approximately 1/4" from being flush with the receive room side of the filler wall. A stethoscope was used to check for any abnormal air leaks around the test specimen prior to testing.



# TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.06-113-11-R0 Date: 01/06/21

#### **SECTION 5**

#### EQUIPMENT

The equipment listed below meets the requirements of the test methods stated in Section 3 of this report.

INSTRUMENT	MANUFACTURER	MODEL	DESCRIPTION	ASSET #	CAL
					DATE
Data Acquisition Card	National Instruments	PXI-4462	Data Acquisition Card	63763-3*	04/20
Data Acquisition Card	National Instruments	PXI-4462	Data Acquisition Card	65125*	05/20
Data Acquisition Card	National Instruments	PXI-4462	Data Acquisition Card	65126*	05/20
Source Room Microphone	PCB Piezotronics	378C20	Microphone and Preamplifier	65968	01/20
Source Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	64903	09/20
Source Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	65103	03/20
Source Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	64905	03/20
Source Room Microphone	PCB piezotronics	378B20	Microphone and Preamplifier	64906	03/20
Receive Room Microphone	PBC Piezotronics	378B20	Microphone and Preamplifier	64907	01/20
Receive Room Microphone	PCB Piezotronics	378C20	Microphone and Preamplifier	64908	01/20
Receive Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	64909	01/20
Receive Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	64910	01/20
Receive Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	65586	08/20
Receive Room Environmental Indicator	Comet	T7510	Receive Room	64915	01/20
Source Room Environmental Indicator	Comet	T7510	Source Room	64914	02/20
Microphone Calibrator	Norsonic	1251	Acoustical Calibrator	Y002919	04/20

\*- Note: The calibration frequency for this equipment is every two years per the manufacturer's recommendation.

#### TEST CHAMBER

	VOLUME	DESCRIPTION
RECEIVE ROOM	234 m³	Rotating vane and stationary diffusers
		Temperature and humidity controlled
		Isolation pads under the floor
SOURCE ROOM	207 m <sup>3</sup>	Stationary diffusers only
		Temperature and humidity controlled

	MAXIMUM SIZE	DESCRIPTION
TL TEST OPENING	4.27 m wide by 3.05 m high	Vibration break between source and receive rooms



# TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.06-113-11-R0 Date: 01/06/21

#### **SECTION 6**

#### LIST OF OFFICIAL OBSERVERS

NAME	COMPANY
Adam Shoemaker	ClarkDietrich Building Systems, LLC
Zachary Golden	Intertek B&C
Kurt Golden	Intertek B&C

#### SECTION 7

#### TEST PROCEDURE

The sensitivity of the microphones was checked before measurements were conducted.

The transmission loss values were obtained for a single direction of measurement.

Two background noise sound pressure level and five sound absorption measurements were conducted at each of five microphone positions.

Two sound pressure level measurements were made simultaneously in receive and source rooms at each of five microphone positions.

The air temperature and relative humidity conditions were monitored and recorded during all measurements.

Data for flanking limit tests, repeatability measurements, and reference specimen tests are available upon request.

Intertek B&C will store samples of test specimens for four years.

#### SECTION 8

## ACOUSTICAL TEST CALCULATIONS

Transmission loss (TL) at each 1/3 octave frequency is the average source room sound pressure level minus the average receive room sound pressure level, plus, 10 times the log of the specimen area divided by the sound absorption of the receive room with the sample in place.

## STC Rating

To obtain the Sound Transmission Class (STC), read the TL of the contour curve at 500 Hz. The sum of the deficiencies below the contour curve must not exceed 32. The maximum deficiency at any one frequency must not exceed 8.

## OITC Rating

The Outdoor-Indoor Transmission Class (OITC) is calculated by subtracting the logarithmic summation of the TL values from the logarithmic summation of the A-weighted transportation noise spectrum stated in ASTM E1332.



# TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.06-113-11-R0 Date: 01/06/21

# **SECTION 9**

#### **SPECIMEN DESCRIPTION**

SOURCE SIDE GYPSUM BOARD	One Layer 5/8" Type X
FURRING CHANNELS	25 Gauge (18 mil)
STUD TREATMENT	ClarkDietrich Sound Clip (CDSC)
BRIDGING	Spazzer 9200 (33 mil), 20-Gauge
STUDS	2-1/2" ProSTUD 25 (15 mil), 25-Gauge Equivalent Steel,
	24" Centers
TRACK	2-1/2" ProTRAK 25 (15 mil), 25-Gauge Equivalent Steel
INSULATION	R-13 Fiberglass Unfaced
RECEIVE SIDE GYPSUM BOARD	One Layer 5/8" Type X

MATERIAL	ACTUAL DIMENSIONS (inches)	ACTUAL THICKNESS (inches)	MANUFACTURER AND SERIES	QUANTITY	AVERAGE WEIGHT				
SOURCE SIDE GYPSUM	48 by 96	0.625	5/8" USG Sheetrock® Brand Firecode® X Panels (UL Type SCX)	2 sheets	2.20 lbs/ft <sup>2</sup>				
BOARD			2" centers. Perimeter and j e. Screw heads sealed with		ith acoustical				
FURRING	2-23/32 by 96	0.002	7/8" Steel, 25 gauge (18 mil)	5 pieces	0.24 lbs/linear ft				
CHANNEL	Note: Space	ed on 24" cente	ers perpendicular to studs, <sub>.</sub>	friction fit into	clips.				
STUD	3 by 1-1/4	0.04	ClarkDietrich Sound Clip™ (CDSC)	15 pieces	0.13 lbs each				
TREATMENT	Note: Used	to attach furri	ng channels. Clips spaced o	on 48" centers.					
BRIDGING	7/8 by 50	0.033	Spazzer 9200 bar 20 gauge (33 mil)	1	0.20 lbs/linear ft				
	Note: Place	d through stud	l cut outs.						
STUD	1-1/4 by 96	2-1/2	ClarkDietrich ProSTUD <sup>®</sup> 25 (15 mil), Steel	5 pieces	0.28 lbs/linear ft				
5100	Note: Spaced on 24" centers. Screwed to top and bottom track.								
INSULATION	24 by 96	3.5	Johns Manville unfaced fiberglass batts	4 pieces	0.21 lbs/ft <sup>2</sup>				
	Note: Fictio								
AIR SPACE	Note: 1" Sp	ace between t	rack and studs.						
INSULATION	24 by 96	3.5	Johns Manville unfaced fiberglass batts	4 pieces	0.21 lbs/ft <sup>2</sup>				
INSOLATION	Note: Fictio								



# TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.06-113-11-R0 Date: 01/06/21

MATERIAL	ACTUAL ACTUAL DIMENSIONS THICKNESS (inches) (inches)		MANUFACTURER AND SERIES	QUANTITY	AVERAGE WEIGHT		
STUD	1-1/4 by 96	2-1/2	ClarkDietrich ProSTUD <sup>®</sup> 25 (15 mil), Steel	5 pieces	0.28 lbs/linear ft		
5100	Note: Space	ed on 24" cente	ers. Screwed to top and bot	tom track.			
BRIDGING	7/8 by 50	0.033	Spazzer 9200 bar 20 gauge (33 mil)	1	0.20 lbs/linear ft		
DRIDGING	Note: Placed through stud cut outs						
RECEIVE SIDE	48 by 96	0.625	5/8" USG Sheetrock® Brand Firecode® X Panels (UL Type SCX)	2 sheets	2.20 lbs/ft <sup>2</sup>		
GYPSUM BOARD		sealed with a	" centers on edge and 12" c coustical sealant and foil to	•			
TOP/ BOTTOM TRACK	1-1/4 by 96 2-1/2		ClarkDietrich ProTRAK <sup>®</sup> 25 (15 mil), Steel	2 pieces	0.32 lbs/linear ft		

TOTAL WEIGHT (lbs)	AVERAGE WEIGHT (lbs/ft <sup>2</sup> )
349.21	5.46

Photographs are included in Section 11.

The client did not supply a report drawing of the test specimen.



# TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.06-113-11-R0 Date: 01/06/21

#### **SECTION 10**

**TEST RESULTS** 

#### L3173.01D3 DATA

SPECIMEN AREA	5.95 m²	RECEIVE TEMP.	21.8 °C	SOURCE TEMP	21.3 °C	
TECHNICIAN	Zachary Gol	RECEIVE HUMIDITY	55%	SOURCE HUMIDIT	54%	

FREQ	BACKGROUND	ABSORPTION	SOURCE	RECEIVE	SPECIMEN	95%	NUMBER
	SPL		SPL	SPL	TL	CONFIDENCE	OF
(Hz)	(dB)	(m²)	(dB)	(dB)	(dB)	LIMIT	DEFICIENCIES
80	41.0	5.7	107	79	29	2.27	-
100	34.1	5.7	108	75	33	2.06	-
125	37.0	6.4	107	71	36	1.78	8
160	39.8	5.5	111	70	41	0.86	6
200	38.8	5.1	110	65	45	0.46	5
250	33.8	5.5	107	58	48	0.45	5
315	27.9	5.9	108	55	54	0.54	2
400	25.2	6.1	110	52	58	0.73	1
500	22.3	6.4	109	47	62	0.39	0
630	23.8	6.0	107	42	65	0.38	0
800	23.6	6.2	107	40	66	0.33	0
1000	19.2	6.5	108	39	69	0.36	0
1250	16.2	7.0	107	37	69	0.33	0
1600	14.3	7.3	106	32	73	0.27	0
2000	12.8	7.8	106	35	70	0.27	0
2500	8.3	8.8	106	35	70	0.36	0
3150	7.8	10.2	105	29	73	0.24	0
4000	9.5	12.5	103	24	76	0.17	0
5000	9.4	15.8	103	19	79	0.34	-
STC RATIN	IG	60	(Sound Tran	smission Clas	s)		
DEFICIEN	CIES	27	(Sum of Defi	ciencies)			
OITC RAT	ING	44	(Outdoor-Ind	door Transmi	ssion Class)		

Notes:

1) Receive Room levels less than 5 dB above the Background levels are red.

2) Specimen TL levels listed in red indicate the lower limit of the transmission loss.


3) Specimen TL levels listed in green indicate that there has been a filler wall correction applied



# TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.06-113-11-R0 Date: 01/06/21

#### L3173.01D3 GRAPH

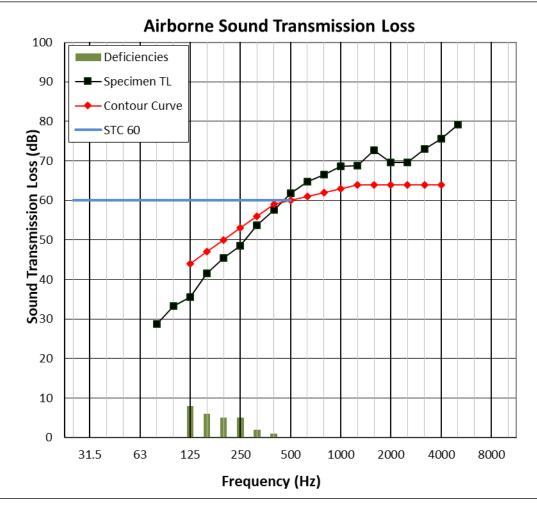



130 Derry Court York, Pennsylvania 17406

Telephone: 717-764-7700 Facsimile: 717-764-4129 www.intertek.com/building

# TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.06-113-11-R0 Date: 01/06/21

# **SECTION 11**

PHOTOGRAPHS



Photo No. 1 Receive Room View of Installed Specimen



Photo No. 2 Source Room View of Installed Specimen



# TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.06-113-11-R0 Date: 01/06/21

# **SECTION 12**

**REVISION LOG** 

<b>REVISION #</b>	DATE	PAGES	REVISION
0	01/06/21	N/A	Original Report Issue