

WESTERN ELECTRO - ACOUSTIC LABORATORY

A division of Veneklasen Associates, Inc.

TESTING • CALIBRATION • RESEARCH

25132 Rye Canyon Loop Santa Clarita, California 91355 Tel: (661) 775-3741 Fax: (661) 775-3742 www.weal.com

SOUND TRANSMISSION LOSS TEST REPORT NO. TL13-194

CLIENT: ClarkDietrich Building Systems 9100 Centre Pointe Drive, Suite 210 West Chester, OH 45069 TEST DATE: 25 February 2013

Page 1 of 2 28 February 2013

INTRODUCTION

The methods and procedures used for each test conform to the provisions and requirements of ASTM E 90-09, Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions and ASTM E2235-04^{¢1}, Standard Test Method for Determination of Decay Rates for Use in Sound Insulation Test Methods. Copies of the test standard are available at <u>www.astm.org</u>. The test chamber source and receiving room volumes are 204 and 148.4 cubic meters respectively. Western Electro-Acoustic Laboratory is accredited by the United States Department of Commerce, National Institute of Standards and Technology under the National Voluntary Accreditation Program (NVLAP) Lab Code 100256-0 for this test procedure. This test report relates only to the item(s) tested. This report must not be used to claim product certification, approval, or endorsement by WEAL, NVLAP, NIST or any agency of the federal government.

DESCRIPTION OF TEST SPECIMEN

The test specimen was a wall assembly constructed from metal studs and Type X gypsum board. The metal studs were 92 mm (3-5/8 inch) ClarkDietrich[™] Building Systems ProSTUD 33 mil and were spaced at 610 mm (24 inches) O.C. The head and sill tracks were also 92 mm (3-5/8 inch) ClarkDietrich ProSTUD 33 mil. The frame was isolated from the test opening with 6.4 mm (1/4 inch) neoprene pads. Full width Owens Corning R-13 un-faced fiberglass batts, 89 mm (3-1/2 inch) thick, were installed in the stud spaces. On both sides two layers of 15.9 mm (5/8 inch) thick USG Type X gypsum board was screwed to the studs at 203 mm (8 inches) O.C. around the perimeter and 305 mm (12 inches) O.C. in the field using 28.6 mm (1-1/8 inch) drywall screws on the first layer and 50.8 mm (2 inch) drywall screws on the second layer. All gypsum board was oriented vertically and the joints were staggered on opposite sides of the wall and between layers. On both sides, the joints and perimeters were sealed with a bead of caulking and metal foil tape. All screw heads were covered with metal foil tape. The overall dimensions of the wall assembly were 2.44 m (96 inches) wide by 2.44 m (96 inches) high by 156 mm (6-1/8 inches) thick. The overall weight of the assembly was estimated to be 286 kg (630 lbs) for a calculated surface density of 48.0 kg/m² (9.84 lbs./ft²).

RESULTS OF THE MEASUREMENTS

One-third octave band sound transmission loss values are plotted and tabulated on the attached sheet. ASTM minimum volume requirements are met at 80 Hz and above. The Outdoor-Indoor Transmission Class rating determined in accordance with ASTM E 1332-10a was OITC-35. The Sound Transmission Class rating determined in accordance with ASTM E 413-10 was STC-45.

Approved:

Gary E. Mange

Gary E. Mange Laboratory Director

Respectfully submitted, Western Electro-Acoustic Laboratory

Raul Martinez


Acoustical Test Technician

Report must be distributed in its entirety except with written authorization from Western Electro-Acoustic Laboratory $\operatorname{Report} \left(\operatorname{A} \right)^{\circ}$

NVLAP LAB CODE 100256-0

WESTERN ELECTRO-ACOUSTIC LABORATORY

Report No. TL13-194

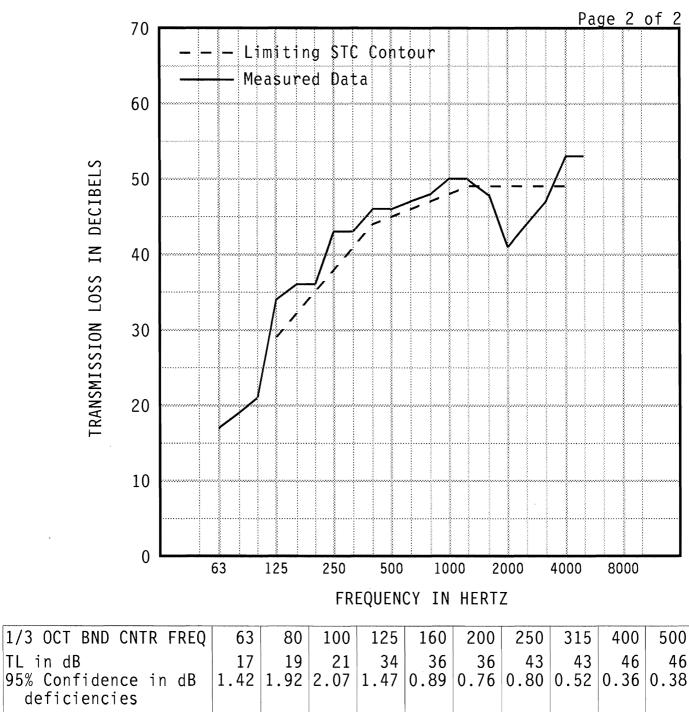

deficienci	ies										
1/3 OCT BND CNTR FREQ		630	800	1000	1250	1600	2000	2500	3150	4000	5000
TL in dB 95% Confidence in dB deficiencies		47 0.29	48 0.44	50 0.38							
EWR OITC 49 35	Specimen Area: 64 sq.ft. Temperature: 67.6 deg. F Relative Humidity: 41 %										STC 45 (16)

Test Date: 25 February 2013

Report must be distributed in its entirety except with written authorization from Western Electro-Acoustic Laboratory

