

627 RIVERBANK DRIVE  
GENEVA, IL 60134

## Test Report

[www.riverbankacoustics.com](http://www.riverbankacoustics.com)

630-232-0104

FOUNDED 1918 BY

WALLACE CLEMENT SABINE

Sound Transmission Loss

**RAL™-TL24-322**

SPONSOR: **ClarkDietrich**

West Chester, OH

CONDUCTED: 2024-07-19

Page 1 of 14

ON: 3-5/8" ProdStud144-22 (22mil) Steel Stud 24" o.c. on 22 mil tracks, 3.5" R-13 Insulation 2 layers  
5/8" Gypsum Source side and 1 layer 5/8" Gypsum Receive side

### TEST METHODOLOGY

Riverbank Acoustical Laboratories™ is accredited by the U.S. Department of Commerce, National Institute of Standards and Technology (NIST) under the National Voluntary Laboratory Accreditation Program (NVLAP) as an ISO 17025:2017 Laboratory (NVLAP Lab Code: 100227-0) and for this test procedure. The test reported in this document conformed explicitly with ASTM E90-09 (2016): "Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions and Elements." The single number rating of the specimen was calculated according to ASTM E413-22: "Classification for Rating Sound Insulation." A description of the measurement procedure and room specifications is available upon request. The transmission loss values are for a single direction of measurement. The results presented in this report apply to the sample as received from the test sponsor.

### INFORMATION PROVIDED BY SPONSOR

The test specimen was designated by the sponsor as 3-5/8" ProdStud144-22 (22mil) Steel Stud 24" o.c. on 22 mil tracks, 3.5" R-13 Insulation 2 layers 5/8" Gypsum Source side and 1 layer 5/8" Gypsum Receive side.

### SPECIMEN MEASUREMENTS & TEST CONDITIONS

Through a full external visual inspection performed on the test specimen, Riverbank personnel verified the following specimen properties:

#### **Tracks (Top & Bottom)**

---

Material:	ProTrak144-22 (22mil)
Dimensions:	2 plates @ 2438 mm (96 in.) wide by 32 mm (1.25 in.) high
Depth:	92 mm (3.625 in.)
Steel Thickness:	0.58 mm (0.02295 in.)
Installation:	Friction fit over foam sill sealer
Overall Weight:	3.52 kg (7.75 lbs)
Mass per Unit Length:	0.72 kg/m (0.48 lbs/ft)



NVLAP LAB CODE 100227-0

RIVERBANK ACOUSTICAL LABORATORIES IS ACCREDITED BY NVLAP (LAB CODE 100227-0) FOR ACOUSTICAL TESTING SERVICES IN ACCORDANCE WITH ISO/IEC 17025:2017 AND FOR THIS PROCEDURE. THIS REPORT MUST NOT BE USED BY THE CLIENT TO CLAIM PRODUCT CERTIFICATION, APPROVAL, OR ENDORSEMENT BY RAL, NVLAP, NIST, OR ANY AGENCY OF THE U.S. GOVERNMENT.

THIS REPORT SHALL NOT BE MODIFIED WITHOUT THE WRITTEN APPROVAL OF RAL. THE RESULTS REPORTED APPLY ONLY TO THE SPECIFIC SAMPLE SUBMITTED FOR TESTING; RAL ASSUMES NO RESPONSIBILITY FOR THE PERFORMANCE OF ANY OTHER SAMPLE.

627 RIVERBANK DRIVE  
GENEVA, IL 60134  
630-232-0104

## Test Report

[www.riverbankacoustics.com](http://www.riverbankacoustics.com)

FOUNDED 1918 BY  
WALLACE CLEMENT SABINE  
**RAL™-TL24-322**

Page 2 of 14

**ClarkDietrich**  
2024-07-19

### SPECIMEN MEASUREMENTS & TEST CONDITIONS (continued)

#### **Studs**

Material: ProStud144-22 (22mil)  
Dimensions: 5 studs @ 37 mm (1.4375 in.) wide by 2743 mm (108 in.) high  
Depth: 92 mm (3.625 in.)  
Steel Thickness: 0.61 mm (0.02385 in.)  
Stud Spacing: Studs spaced 610 mm (24 in.) on center  
Installation: Side studs each fastened to test frame at midpoint with 1 screw each  
Studs fit into top and bottom tracks, left floating  
Fasteners: Type W bugle head drywall screws, length @ 32 mm (1.25 in.)  
Overall Weight: 11.11 kg (24.5 lbs)  
Mass per Unit Length: 0.81 kg/m (0.54 lbs/ft)

*Note: A bead of acoustical sealant was used to seal the source side of the specimen where framing members met the test frame (0.91 kg (2 lbs) total).*

#### **Insulation**

Material: R-13 unfaced fiberglass  
Dimensions: 4 pieces @ 610 mm (24 in.) wide by 2438 mm (96 in.) high  
4 pieces @ 610 mm (24 in.) wide by 305 mm (12 in.) high  
Depth: 89 mm (3.5 in.)  
Installation: Friction fit between studs  
Overall Weight: 7.37 kg (16.25 lbs)  
Mass per Unit Volume: 12.4 kg/m<sup>3</sup> (0.77 lbs/ft<sup>3</sup>)

#### **Source Room Side**

##### **Base Layer**

Material: Type X gypsum board  
Dimensions: 2 panels @ 1219 mm (48 in.) wide by 2743 mm (108 in.) high  
Thickness: 16 mm (0.625 in.)  
Installation: Panels installed vertically and fastened to studs with screws  
Fasteners: Type S bugle head drywall screws, length @ 32 mm (1.25 in.)  
Fastener Spacing: 406 mm (16 in.) on center  
If a screw fell on a "stud to track" condition, that screw was offset L or R by 1" to avoid the track to stud connection  
Overall Weight: 73.37 kg (161.75 lbs)  
Mass Per Unit Area: 10.97 kg/m<sup>2</sup> (2.25 lbs/ft<sup>2</sup>)



NVLAP LAB CODE 100227-0

RIVERBANK ACOUSTICAL LABORATORIES IS ACCREDITED BY NVLAP (LAB CODE 100227-0) FOR ACOUSTICAL TESTING SERVICES IN ACCORDANCE WITH ISO/IEC 17025:2017 AND FOR THIS PROCEDURE. THIS REPORT MUST NOT BE USED BY THE CLIENT TO CLAIM PRODUCT CERTIFICATION, APPROVAL, OR ENDORSEMENT BY RAL, NVLAP, NIST, OR ANY AGENCY OF THE U.S. GOVERNMENT.

THIS REPORT SHALL NOT BE MODIFIED WITHOUT THE WRITTEN APPROVAL OF RAL. THE RESULTS REPORTED APPLY ONLY TO THE SPECIFIC SAMPLE SUBMITTED FOR TESTING; RAL ASSUMES NO RESPONSIBILITY FOR THE PERFORMANCE OF ANY OTHER SAMPLE.

627 RIVERBANK DRIVE  
GENEVA, IL 60134  
630-232-0104

## Test Report

[www.riverbankacoustics.com](http://www.riverbankacoustics.com)

FOUNDED 1918 BY  
WALLACE CLEMENT SABINE  
**RAL™-TL24-322**

Page 3 of 14

**ClarkDietrich**  
2024-07-19

### SPECIMEN MEASUREMENTS & TEST CONDITIONS (continued)

#### Source Room Side (continued)

##### **Face Layer**

Material: Type X gypsum board  
Dimensions: 1 panel @ 1219 mm (48 in.) wide by 2743 mm (108 in.) high  
2 panels @ 610 mm (24 in.) wide by 2743 mm (108 in.) high  
Thickness: 16 mm (0.625 in.)  
Installation: Panels installed vertically, fastened to studs through base layer with screws  
Panel joints staggered from source side base layer panel joints  
Fasteners: Type S bugle head drywall screws, length @ 41 mm (1.625 in.)  
Fastener Spacing: 406 mm (16 in.) on center, offset by 203 mm (8 in.) from base layer  
If a screw fell on a “stud to track” condition, that screw was offset L or R by 1” to avoid the track to stud connection  
Overall Weight: 73.14 kg (161.25 lbs)  
Mass Per Unit Area: 10.93 kg/m<sup>2</sup> (2.24 lbs/ft<sup>2</sup>)

#### Receive Room Side

Material: Type X gypsum board  
Dimensions: 1 panel @ 1219 mm (48 in.) wide by 2743 mm (108 in.) high  
2 panels @ 610 mm (24 in.) wide by 2743 mm (108 in.) high  
Thickness: 16 mm (0.625 in.)  
Installation: Panels installed vertically, fastened to studs with screws  
Panel joints staggered from source side base layer panel joints  
Fasteners: Type S bugle head drywall screws, length @ 32 mm (1.25 in.)  
Fastener Spacing: 203 mm (8 in.) on center perimeter, 305 mm (12 in.) on center field  
If a screw fell on a “stud to track” condition, that screw was offset L or R by 1” to avoid the track to stud connection  
Overall Weight: 73.03 kg (161 lbs)  
Mass Per Unit Area: 10.92 kg/m<sup>2</sup> (2.24 lbs/ft<sup>2</sup>)

*Note: Joints between gypsum board panels, and screw heads on both sides of the partition were treated with a thin bead of acoustical sealant and metal tape (0.45 kg (1 lbs) total).*



NVLAP LAB CODE 100227-0

RIVERBANK ACOUSTICAL LABORATORIES IS ACCREDITED BY NVLAP (LAB CODE 100227-0) FOR ACOUSTICAL TESTING SERVICES IN ACCORDANCE WITH ISO/IEC 17025:2017 AND FOR THIS PROCEDURE. THIS REPORT MUST NOT BE USED BY THE CLIENT TO CLAIM PRODUCT CERTIFICATION, APPROVAL, OR ENDORSEMENT BY RAL, NVLAP, NIST, OR ANY AGENCY OF THE U.S. GOVERNMENT.

THIS REPORT SHALL NOT BE MODIFIED WITHOUT THE WRITTEN APPROVAL OF RAL. THE RESULTS REPORTED APPLY ONLY TO THE SPECIFIC SAMPLE SUBMITTED FOR TESTING; RAL ASSUMES NO RESPONSIBILITY FOR THE PERFORMANCE OF ANY OTHER SAMPLE.

627 RIVERBANK DRIVE  
GENEVA, IL 60134  
630-232-0104

## Test Report

[www.riverbankacoustics.com](http://www.riverbankacoustics.com)

FOUNDED 1918 BY  
WALLACE CLEMENT SABINE  
**RAL™-TL24-322**

Page 4 of 14

### SPECIMEN MEASUREMENTS & TEST CONDITIONS (continued)

#### Overall Specimen Measurements

Dimensions: 2.44 m (96.0 in) wide by 2.74 m (108.0 in) high  
Thickness: 0.14 m (5.5 in)  
Weight: 242.67 kg (535.0 lbs)  
Overall Area: 6.689 m<sup>2</sup> (72. ft<sup>2</sup>)  
Mass per Unit Area: 36.28 kg/m<sup>2</sup> (7.43 lbs/ft<sup>2</sup>)

#### Test Aperture

Opening Size: 2.74 m (9.0 ft.) by 4.27 m (14.0 ft.)  
Filler Wall: Yes  
Aperture Size: 2.44 m (96.0 in) wide by 2.74 m (108.0 in) high  
Transmission Area: 6.689 m<sup>2</sup> (72. ft<sup>2</sup>)  
Sealed: Entire periphery (both sides) with dense mastic

#### Test Environment

##### Source Room

Volume: 177.11 m<sup>3</sup>  
Temperature: 22.8 °C ± 0.0 °C  
Relative Humidity: 56.5 % ± 1.0 %

##### Receive Room

Volume: 178.33 m<sup>3</sup>  
Temperature: 22.2 °C ± 0.0 °C  
Relative Humidity: 55.0 % ± 0.0 %

##### Requirements

Temperature: 22° C +/- 2° C, not more than 3° C change over all tests.  
Relative Humidity: ≥ 30%, not more than +/- 3% change over all tests.



NVLAP LAB CODE 100227-0

RIVERBANK ACOUSTICAL LABORATORIES IS ACCREDITED BY NVLAP (LAB CODE 100227-0) FOR ACOUSTICAL TESTING SERVICES IN ACCORDANCE WITH ISO/IEC 17025:2017 AND FOR THIS PROCEDURE. THIS REPORT MUST NOT BE USED BY THE CLIENT TO CLAIM PRODUCT CERTIFICATION, APPROVAL, OR ENDORSEMENT BY RAL, NVLAP, NIST, OR ANY AGENCY OF THE U.S. GOVERNMENT.

THIS REPORT SHALL NOT BE MODIFIED WITHOUT THE WRITTEN APPROVAL OF RAL. THE RESULTS REPORTED APPLY ONLY TO THE SPECIFIC SAMPLE SUBMITTED FOR TESTING; RAL ASSUMES NO RESPONSIBILITY FOR THE PERFORMANCE OF ANY OTHER SAMPLE.

627 RIVERBANK DRIVE  
GENEVA, IL 60134

630-232-0104

**ClarkDietrich**  
2024-07-19

## Test Report

[www.riverbankacoustics.com](http://www.riverbankacoustics.com)

FOUNDED 1918 BY  
WALLACE CLEMENT SABINE  
**RAL™-TL24-322**

Page 5 of 14



Figure 1 – Specimen mounted in test aperture, as viewed from source room



Figure 2 – Specimen mounted in test aperture, as viewed from receive room



NVLAP LAB CODE 100227-0

RIVERBANK ACOUSTICAL LABORATORIES IS ACCREDITED BY NVLAP (LAB CODE 100227-0) FOR ACOUSTICAL TESTING SERVICES IN ACCORDANCE WITH ISO/IEC 17025:2017 AND FOR THIS PROCEDURE. THIS REPORT MUST NOT BE USED BY THE CLIENT TO CLAIM PRODUCT CERTIFICATION, APPROVAL, OR ENDORSEMENT BY RAL, NVLAP, NIST, OR ANY AGENCY OF THE U.S. GOVERNMENT.

THIS REPORT SHALL NOT BE MODIFIED WITHOUT THE WRITTEN APPROVAL OF RAL. THE RESULTS REPORTED APPLY ONLY TO THE SPECIFIC SAMPLE SUBMITTED FOR TESTING; RAL ASSUMES NO RESPONSIBILITY FOR THE PERFORMANCE OF ANY OTHER SAMPLE.



627 RIVERBANK DRIVE  
GENEVA, IL 60134

630-232-0104

ClarkDietrich  
2024-07-19

## Test Report

[www.riverbankacoustics.com](http://www.riverbankacoustics.com)

FOUNDED 1918 BY  
WALLACE CLEMENT SABINE  
**RAL™-TL24-322**

Page 6 of 14



Figure 3 – Tracks and studs installed in test aperture



Figure 4 – Detail of side stud fastened to test frame

627 RIVERBANK DRIVE  
GENEVA, IL 60134

630-232-0104

**ClarkDietrich**  
2024-07-19

## Test Report

[www.riverbankacoustics.com](http://www.riverbankacoustics.com)

FOUNDED 1918 BY  
WALLACE CLEMENT SABINE  
**RAL™-TL24-322**

Page 7 of 14



Figure 5 – Insulation installed in stud cavities, receive room side partially installed, viewed from receive room



Figure 6 – Insulation installed in stud cavities, receive room side partially installed, viewed from receive room



627 RIVERBANK DRIVE  
GENEVA, IL 60134

630-232-0104

**ClarkDietrich**  
2024-07-19

## Test Report

[www.riverbankacoustics.com](http://www.riverbankacoustics.com)

FOUNDED 1918 BY  
WALLACE CLEMENT SABINE  
**RAL™-TL24-322**

Page 8 of 14



Figure 7 – Source room side base layer gypsum board installed



Figure 8 – Source room side face layer gypsum board partially installed



627 RIVERBANK DRIVE  
GENEVA, IL 60134

630-232-0104

## Test Report

[www.riverbankacoustics.com](http://www.riverbankacoustics.com)

FOUNDED 1918 BY

WALLACE CLEMENT SABINE

**RAL™-TL24-322**

Page 9 of 14

**ClarkDietrich**

2024-07-19

### TEST RESULTS

Sound transmission loss values are tabulated at the eighteen standard frequency bands. A graphic presentation of the data and additional information appear on the following pages. The precision of the transmission loss test data is within the limits set by the ASTM Standard E90-09 (2016). See Appendix A for identification of corrections applied to the reported data.

<u>FREQ.</u>	<u>TL</u>	<u>ΔTL</u>	<u>DEF.</u>	<u>FREQ.</u>	<u>TL</u>	<u>ΔTL</u>	<u>DEF.</u>
100	23	0.90	0	800	54	0.18	0
125	35	0.66	0	1000	55	0.12	0
160	37	0.53	0	1250	58	0.08	0
200	42	0.48	0	1600	57	0.10	0
250	41	0.49	1	2000	48	0.08	5
315	45	0.35	0	2500	45	0.10	8
400	46	0.31	2	3150	47	0.06	6
500	48	0.21	1	4000	53	0.07	0
630	52	0.22	0	5000	57	0.06	0

STC=49

### ABBREVIATION INDEX

FREQ. = 1/3 OCTAVE BAND CENTER FREQUENCY, Hz

TL = TRANSMISSION LOSS, dB

ΔTL = 95% CONFIDENCE INTERVAL FOR TL MEASUREMENTS, dB

DEF. = DEFICIENCIES, dB BELOW SHIFTED STC CONTOUR (SUM OF DEF = 23)

STC = SOUND TRANSMISSION CLASS

Tested by

*Marc Sciaky*

Marc Sciaky  
Senior Experimentalist

Report by

*Keith Kimberling*

Keith Kimberling  
Test Engineer

Approved by

*Eric P. Wolfram*

Eric P. Wolfram  
Laboratory Manager



NVLAP LAB CODE 100227-0

RIVERBANK ACOUSTICAL LABORATORIES IS ACCREDITED BY NVLAP (LAB CODE 100227-0) FOR ACOUSTICAL TESTING SERVICES IN ACCORDANCE WITH ISO/IEC 17025:2017 AND FOR THIS PROCEDURE. THIS REPORT MUST NOT BE USED BY THE CLIENT TO CLAIM PRODUCT CERTIFICATION, APPROVAL, OR ENDORSEMENT BY RAL, NVLAP, NIST, OR ANY AGENCY OF THE U.S. GOVERNMENT.

THIS REPORT SHALL NOT BE MODIFIED WITHOUT THE WRITTEN APPROVAL OF RAL. THE RESULTS REPORTED APPLY ONLY TO THE SPECIFIC SAMPLE SUBMITTED FOR TESTING; RAL ASSUMES NO RESPONSIBILITY FOR THE PERFORMANCE OF ANY OTHER SAMPLE.

627 RIVERBANK DRIVE  
GENEVA, IL 60134  
630-232-0104

ClarkDietrich  
2024-07-19


Test Report

[www.riverbankacoustics.com](http://www.riverbankacoustics.com)

FOUNDED 1918 BY  
WALLACE CLEMENT SABINE  
**RAL™-TL24-322**  
Page 10 of 14

SOUND TRANSMISSION REPORT

3-5/8" ProdStud I44-22 (22mil) Steel Stud 24" o.c. on 22 mil tracks, 3.5" R-13 Insulation  
2 layers 5/8" Gypsum Source side and 1 layer 5/8" Gypsum Receive side

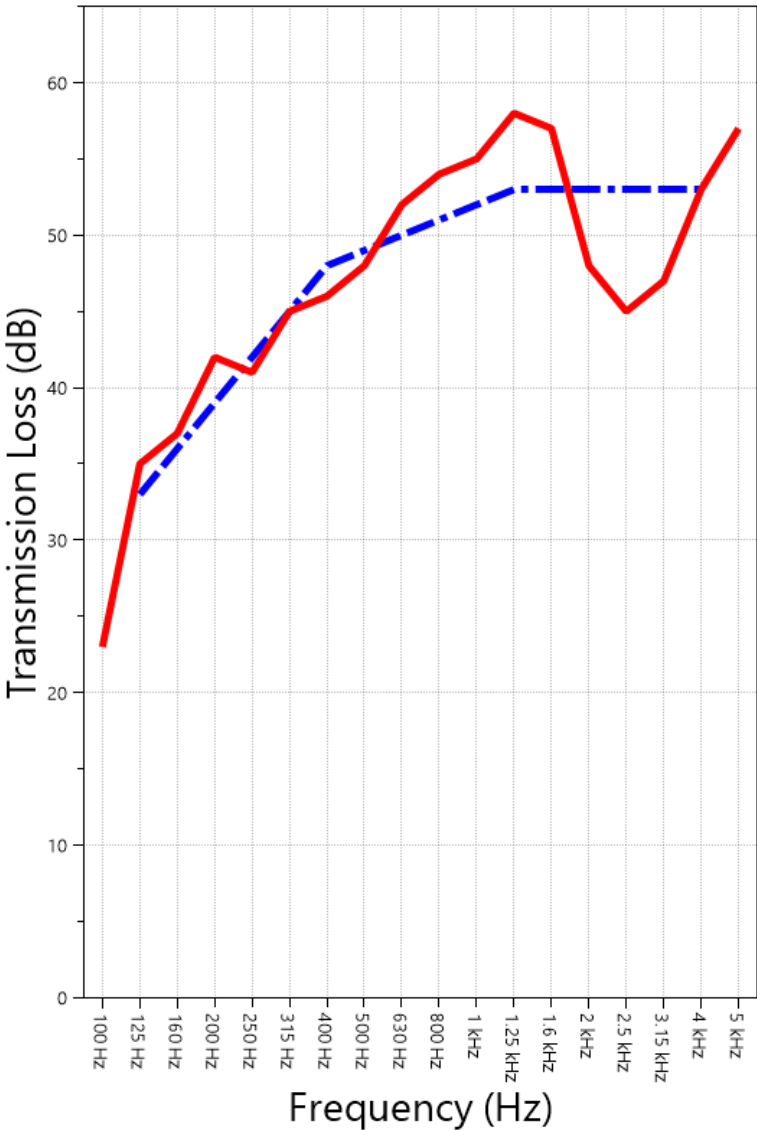

STC=49  
OITC=35



TRANSMISSION LOSS  
SOUND TRANSMISSION CLASS CONTOUR



NVLAP LAB CODE 100227-0

RIVERBANK ACOUSTICAL LABORATORIES IS ACCREDITED BY NVLAP (LAB CODE 100227-0) FOR ACOUSTICAL TESTING SERVICES IN ACCORDANCE WITH ISO/IEC 17025:2017 AND FOR THIS PROCEDURE. THIS REPORT MUST NOT BE USED BY THE CLIENT TO CLAIM PRODUCT CERTIFICATION, APPROVAL, OR ENDORSEMENT BY RAL, NVLAP, NIST, OR ANY AGENCY OF THE U.S. GOVERNMENT.

THIS REPORT SHALL NOT BE MODIFIED WITHOUT THE WRITTEN APPROVAL OF RAL. THE RESULTS REPORTED APPLY ONLY TO THE SPECIFIC SAMPLE SUBMITTED FOR TESTING; RAL ASSUMES NO RESPONSIBILITY FOR THE PERFORMANCE OF ANY OTHER SAMPLE.

627 RIVERBANK DRIVE  
GENEVA, IL 60134  
630-232-0104

Test Report

[www.riverbankacoustics.com](http://www.riverbankacoustics.com)

FOUNDED 1918 BY  
WALLACE CLEMENT SABINE  
**RAL™-TL24-322**  
Page 11 of 14

ClarkDietrich  
2024-07-19

**APPENDIX A: Extended Frequency Range Data**

Specimen: 3-5/8” ProdStud144-22 (22mil) Steel Stud 24” o.c. on 22 mil tracks, 3.5” R-13 Insulation 2 layers  
5/8” Gypsum Source side and 1 layer 5/8” Gypsum Receive side (See Full Report)

The following non-accredited data were obtained in accordance with ASTM E90-09 (2016), but extend beyond the defined frequency range of 100Hz to 5,000Hz. These unofficial results are representative of the RAL test environment only and intended for research & comparison purposes. Sampling precision observed during this procedure is reported below. Corrections are detailed in Appendix B.

1/3 Octave Band Center Frequency (Hz)	Sound Transmission Loss (dB)	Applicable Corrections	ΔTL (Eq. A2.5) (dB)	Repeatability (dB)
31.5	21	ZZ F	1.76	1.01
40	22	Z F	0.76	2.26
50	17		0.57	1.52
63	13		0.54	1.47
80	17		0.56	0.60
100	23		0.90	0.67
125	35		0.66	0.71
160	37		0.53	0.35
200	42	Z F	0.48	0.33
250	41		0.49	0.42
315	45		0.35	0.41
400	46		0.31	0.46
500	48		0.21	0.18
630	52		0.22	0.26
800	54		0.18	0.24
1000	55		0.12	0.27
1250	58		0.08	0.15
1600	57		0.10	0.12
2000	48		0.08	0.13
2500	45		0.10	0.19
3150	47		0.06	0.14
4000	53		0.07	0.17
5000	57		0.06	0.17
6300	60		0.08	0.21
8000	62	Z	0.06	0.50
10000	61	Z F	0.09	1.21
12500	56	Z F	0.18	1.74



627 RIVERBANK DRIVE  
GENEVA, IL 60134  
630-232-0104

## Test Report

[www.riverbankacoustics.com](http://www.riverbankacoustics.com)

FOUNDED 1918 BY  
WALLACE CLEMENT SABINE  
**RAL™-TL24-322**  
Page 12 of 14

ClarkDietrich  
2024-07-19

### APPENDIX B: Glossary of Standardized Corrections and Adjustments

Specimen: 3-5/8" ProdStud144-22 (22mil) Steel Stud 24" o.c. on 22 mil tracks, 3.5" R-13 Insulation 2 layers 5/8" Gypsum Source side and 1 layer 5/8" Gypsum Receive side (See Full Report)

#### Mark Interpretation

- A** Measured sound pressure levels in the receive room are within 10 dB of the ambient noise level at the marked frequency band. Receive room levels used to calculate Transmission Loss are corrected according to ASTM E90 Section 10.3.
- AA** Measured sound pressure levels in the receive room are within 5 dB of the ambient noise level at the marked frequency band. Receive room levels used to calculate Transmission Loss are corrected according to ASTM E90 Section 10.3.1. Transmission Loss values calculated from levels corrected this way will be less than or equal to Transmission Loss values from a hypothetical test using the same specimen and a receive room with idealized ambient sound levels of  $(-\infty)$  dB.
- F** The reported Transmission Loss is within 10 dB of the laboratory flanking limit at the marked frequency band. The measured performance of the specimen may be limited by the performance of the laboratory building structure at this frequency band.
- Z** The reported Transmission Loss at the marked frequency band has been corrected according to ASTM E90 Section A3.2.7 to account for possible sound transmission through the filler assembly.
- ZZ** The reported Transmission Loss at the marked frequency band has been corrected according to ASTM E90 Section A3.2.8 to account for possible sound transmission through the filler assembly. Transmission Loss values corrected this way will be less than or equal to Transmission Loss values from a hypothetical test using the same specimen and an idealized filler assembly with a Sound Transmission Class rating of  $(\infty)$ .

### APPENDIX C: Glossary of Variability Metrics

Specimen: 3-5/8" ProdStud144-22 (22mil) Steel Stud 24" o.c. on 22 mil tracks, 3.5" R-13 Insulation 2 layers 5/8" Gypsum Source side and 1 layer 5/8" Gypsum Receive side (See Full Report)

**ATL**, the 95% confidence interval for reported transmission loss values, is calculated from the standard deviation of the sets of measurements for source room sound pressure level, receive room sound pressure level, and receive room sound absorption. This metric is calculated in an effort to quantify the combined influences of room geometry, microphone positioning, and other varying environmental conditions on reported results.

**Repeatability**, expressed as a 95% confidence interval, is calculated from the standard deviation of transmission loss as obtained from a set of six (6) consecutive tests conducted according to this test method by RAL on 2020-02-13. The tests were performed on a specimen composed of 24 gauge steel paneling, using the same test opening as used in this report. This metric provides an estimate of the variation in results that might be observed if the test were repeated with no change to the installed specimen. Note that repeatability will vary with the construction type.



NVLAP LAB CODE 100227-0

RIVERBANK ACOUSTICAL LABORATORIES IS ACCREDITED BY NVLAP (LAB CODE 100227-0) FOR ACOUSTICAL TESTING SERVICES IN ACCORDANCE WITH ISO/IEC 17025:2017 AND FOR THIS PROCEDURE. THIS REPORT MUST NOT BE USED BY THE CLIENT TO CLAIM PRODUCT CERTIFICATION, APPROVAL, OR ENDORSEMENT BY RAL, NVLAP, NIST, OR ANY AGENCY OF THE U.S. GOVERNMENT.

THIS REPORT SHALL NOT BE MODIFIED WITHOUT THE WRITTEN APPROVAL OF RAL. THE RESULTS REPORTED APPLY ONLY TO THE SPECIFIC SAMPLE SUBMITTED FOR TESTING; RAL ASSUMES NO RESPONSIBILITY FOR THE PERFORMANCE OF ANY OTHER SAMPLE.

627 RIVERBANK DRIVE  
GENEVA, IL 60134  
630-232-0104

Test Report

[www.riverbankacoustics.com](http://www.riverbankacoustics.com)

FOUNDED 1918 BY  
WALLACE CLEMENT SABINE  
**RAL™-TL24-322**  
Page 13 of 14

ClarkDietrich  
2024-07-19

**APPENDIX D: Determination of Outdoor Indoor Transmission Class (OITC)**

Specimen: 3-5/8” ProdStud144-22 (22mil) Steel Stud 24” o.c. on 22 mil tracks, 3.5” R-13 Insulation 2 layers 5/8” Gypsum Source side and 1 layer 5/8” Gypsum Receive side (See Full Report)

The determination of the Outdoor Indoor Transmission Class (OITC) as reported below was made with explicit conformity to the procedures described in the ASTM E1332-22 test standard. Test Method ASTM E90-09 (2016) was used to obtain the sound transmission loss data. This rating is based on an average transportation noise source spectrum and an A-weighted sound level reduction, either of which may be inappropriate for some applications.

One-third Octave Band Center Frequency, Hz	Reference Sound Spectrum, dB	Test Specimen Transmission Loss, dB
80	103	17
100	102	23
125	101	35
160	98	37
200	97	42
250	95	41
315	94	45
400	93	46
500	93	48
630	91	52
800	90	54
1000	89	55
1250	89	58
1600	88	57
2000	88	48
2500	87	45
3150	85	47
4000	84	53

*OITC = 35*

627 RIVERBANK DRIVE  
GENEVA, IL 60134  
630-232-0104

Test Report

[www.riverbankacoustics.com](http://www.riverbankacoustics.com)

FOUNDED 1918 BY  
WALLACE CLEMENT SABINE  
**RAL™-TL24-322**  
Page 14 of 14

ClarkDietrich  
2024-07-19

**APPENDIX E: Instruments of Traceability**

Specimen: 3-5/8” ProdStud144-22 (22mil) Steel Stud 24” o.c. on 22 mil tracks, 3.5” R-13 Insulation 2 layers  
5/8” Gypsum Source side and 1 layer 5/8” Gypsum Receive side (See Full Report)

<u>Description</u>	<u>Model</u>	<u>Serial Number</u>	<u>Date of Certification</u>	<u>Calibration Due</u>
System 2	Type 3160-A-042	3160-106974	2023-08-11	2024-08-11
Bruel & Kjaer Mic And Preamp C	Type 4943-B-001	2311439	2024-03-29	2025-03-29
EXTECH Hygro 663	SD700	A083663	2023-12-28	2024-12-28
EXTECH Hygro 639	SD700	A.103639	2023-12-01	2024-12-01

**APPENDIX F: Revisions to Original Test Report**

Specimen: 3-5/8” ProdStud144-22 (22mil) Steel Stud 24” o.c. on 22 mil tracks, 3.5” R-13 Insulation 2  
layers 5/8” Gypsum Source side and 1 layer 5/8” Gypsum Receive side (See Full Report)

<u>Date</u>	<u>Revision</u>
2024-08-22	Original report issued

END